# Nanodyne Replacement Illuminator for Zeiss Axiovert Microscope Installation Instructions



(1) Original Zeiss Axiovert Illuminator

Note that the photo at right shows an older version of the illuminator.

The current version is shown on sheet 2.



(2) Nanodyne Replacement Illuminator for Zeiss Axiovert

Wayne Bonin	4/2	1/20	19
PN 10760 Zeiss Axiovert Illuminator Installation			REV 3
SHEET	1	OF	6

© Copyright 2019 Nanodyne Measurement Systems. Document authorized for installation of Nanodyne equipment only. www.nano-dyne.com Wayne Bonin 651-323-8592

2

#### Nanodyne Replacement Illuminator for Zeiss Axiovert Microscope Installation Instructions - Included Items **Additional Items Included But Not Shown:**

# PN 10490 Hex Key 5/64 inch for set screw




PN 10733 Power Supply - XP Power 5V 1A Fixed Blade US Input/USB Output and PN 10734 Cable Assy 1.35mm ID x 3.5mm OD RA plug to USB A, 6 foot.

The illuminator may be powered by plugging the cable into the power supply provided, or into a suitable USB port on a computer or other device.


> Power supplies are subject to substitution without notice due to availability issues and changes in regulations.


Wayne Bonin 4/21/20		19		
PN 10760 Zeiss Axiovert Iluminator Installation			REV 3	
SHEET	2	OF	6	

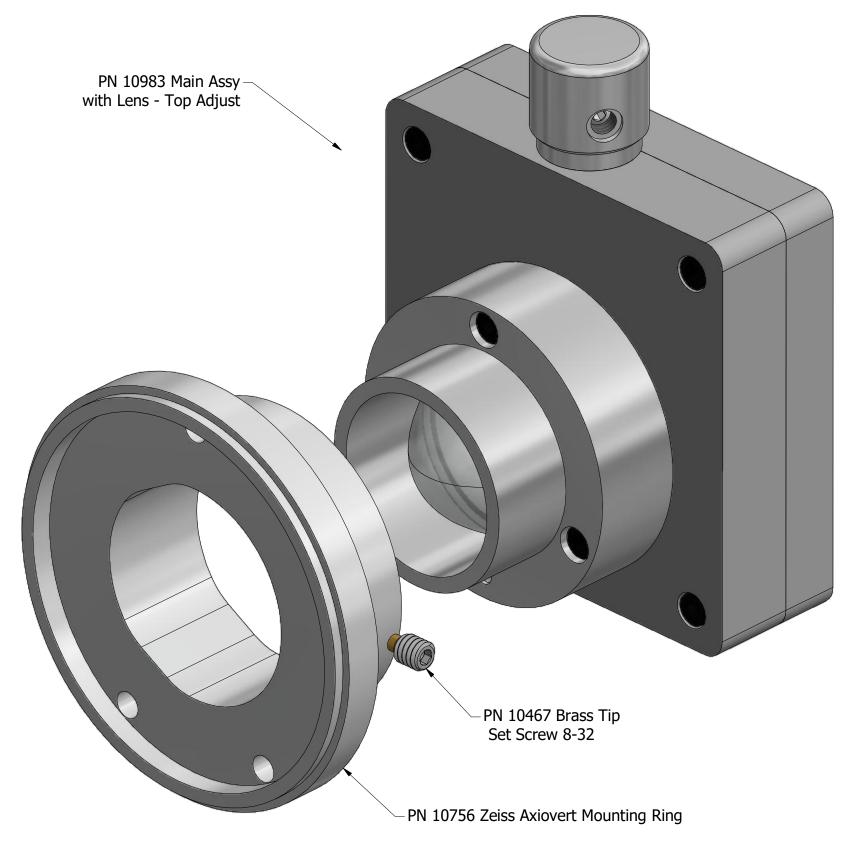

© Copyright 2019 Nanodyne Measurement Systems. Document authorized for installation of Nanodyne equipment only. www.nano-dyne.com Wayne Bonin 651-323-8592

# Nanodyne Replacement Illuminator for Zeiss Axiovert Microscope Installation Instructions: Step 1. Remove old lamp housing.

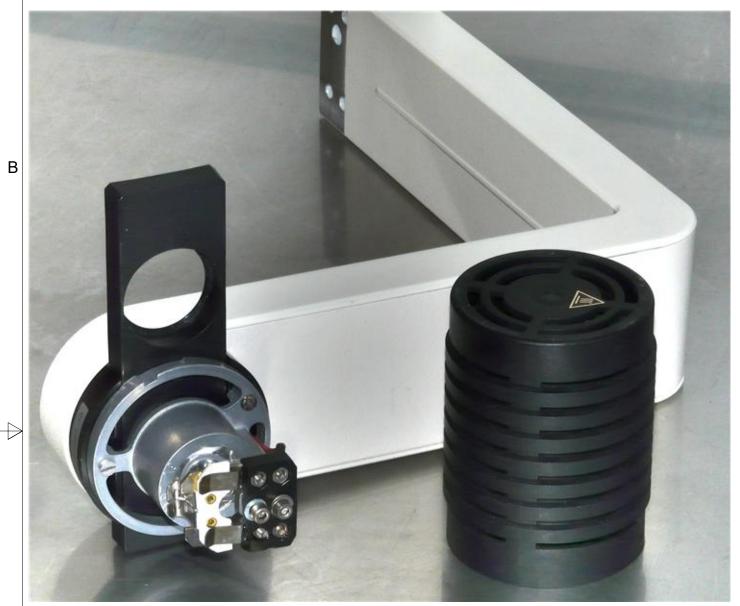

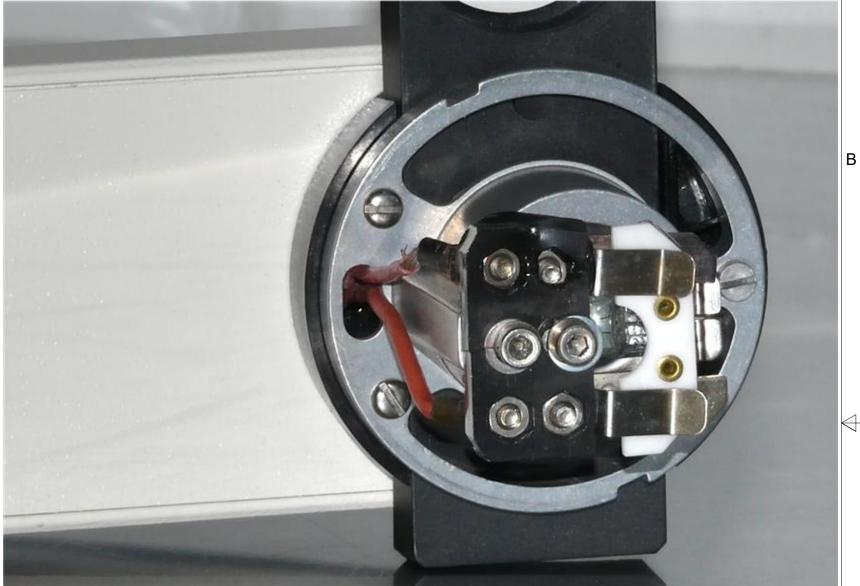

(1) Remove the lamp housing by twisting counter clock wise and pulling it off.

(2) Note the three screws holding the lamp/collector lens assembly in place.

### Do Not Remove the Arm From the Microscope.

A customer sent us the arm only, for us to design the replacement illuminator.

Wayne Bonin	4/21	1/20	19
PN 10760 Zeiss Axiovert Illuminator Installation			REV 3
SHEET	3	OF	6

© Copyright 2019 Nanodyne Measurement Systems. Document authorized for installation of Nanodyne equipment only. www.nano-dyne.com Wayne Bonin 651-323-8592


2

# Nanodyne Replacement Illuminator for Zeiss Axiovert Microscope Installation Instructions: Step 2. Remove old lamp/collector lens assembly and wires.





Retain the three screws and the filter holder as they will be used with the new illuminator.

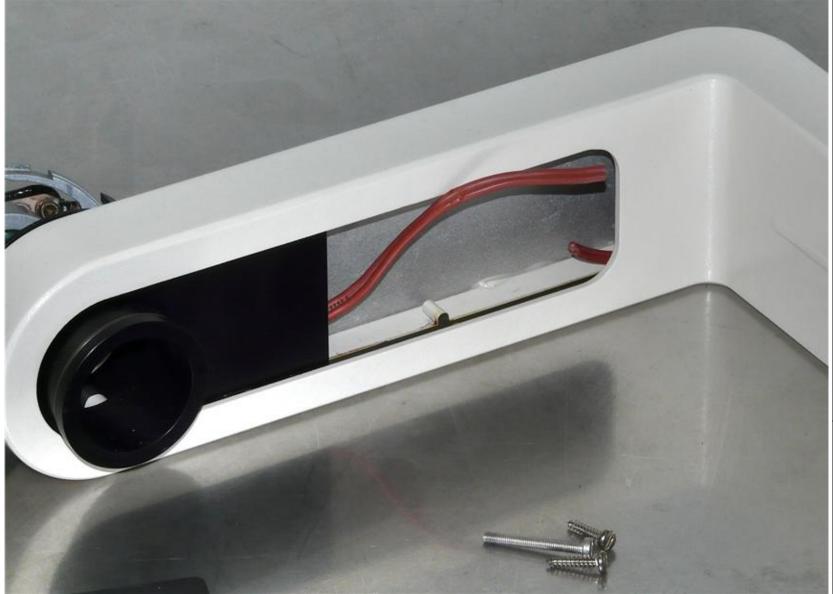

(2) Cut the power leads to the old lamp as shown above. Either insulate the end of the wires remaining in the microscope, or completely remove the wire and/or original power supply so there is no possibility of power being applied to the old wiring.

	Wayne Bonin	4/21/2019		
PN 10760 Zeiss Axiovert Illuminator Installation				REV 3
	SHEET	4	OF	6

© Copyright 2019 Nanodyne Measurement Systems. Document authorized for installation of Nanodyne equipment only. www.nano-dyne.com Wayne Bonin 651-323-8592

)

 $\downarrow$  3  $\downarrow$  2

# Nanodyne Replacement Illuminator for Zeiss Axiovert Microscope Installation Instructions: Step 3. Re-install filter holder.








(2) Replace the filter holder as shown above.

Wayne Bonin	4/2	19	
PN 10760 Zeiss Axiovert Illuminator Installation			REV 3
SHEET	5	OF	6

© Copyright 2019 Nanodyne Measurement Systems. Document authorized for installation of Nanodyne equipment only. www.nano-dyne.com Wayne Bonin 651-323-8592

2

# Nanodyne Replacement Illuminator for Zeiss Axiovert Microscope Installation Instructions: Step 4. Attach Nanodyne adapter and illuminator.

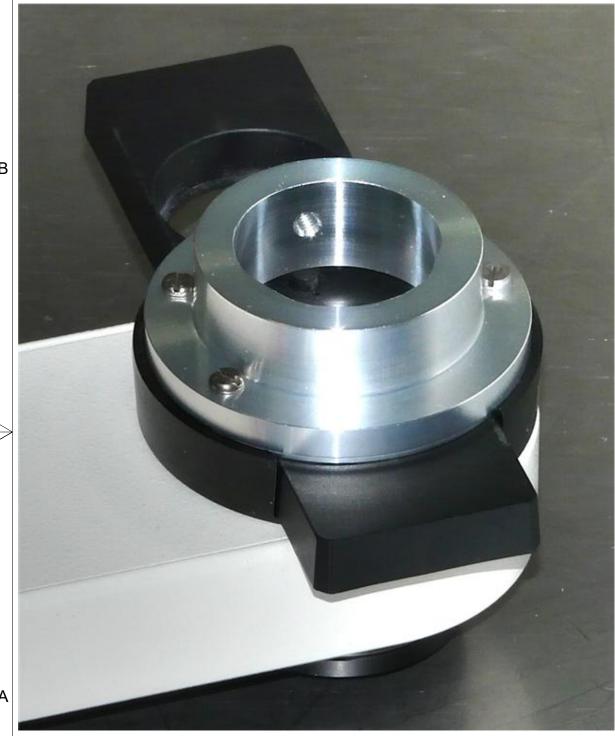

(1) Using the three screws from the original illuminator, attach PN 10756 adapter ring as shown above. Although not visible above, the brass tip set screw should be visible but not protruding into the inner diameter of the adapter ring.

Note that the photo at right shows an older version of the illuminator.

The current version is shown on sheet 2.



(2) Insert PN 10983 Illuminator Assembly into the adapter ring and secure in place using the 5/64 hex key to tighten the set screw. After attaching the power supply, the unit is ready to operate. To avoid confusion it might be good to black out the "6V 25W / 30W" text from the original illuminator with a permanent marker.

Wayne Bonin	e Bonin 4/21/2019	
PN 10760 Zeiss Axiovert Illuminator Installation		REV 3
SHEET	6 OF	6

© Copyright 2019 Nanodyne Measurement Systems. Document authorized for installation of Nanodyne equipment only. www.nano-dyne.com Wayne Bonin 651-323-8592

3